

Welcome CHRIS MEYERKORT

Leading source of Online Diagnostic & Repair Information

Your Vehicle: 2006 Mazda Mazdaspeed6 L4-2.3L Turbo



<u>Vehicle</u> » <u>Technical Service Bulletins</u> » <u>All Technical Service Bulletins</u> » <u>Drivetrain - Oil Seepage From Transfer</u> <u>Case</u>

<u>Notes</u>


Drivetrain - Oil Seepage From Transfer Case

Bulletin No: 03-001/08

Last Issued: 01/09/2008 Subject: OIL SEEPAGE FROM <u>TRANSFER CASE</u>

APPLICABLE MODEL(S)/VINs 2006-2007 Mazdaspeed6 vehicles with VINs lower than JM1GG12L*7*108052 (produced before July 1, 2006)

DESCRIPTION

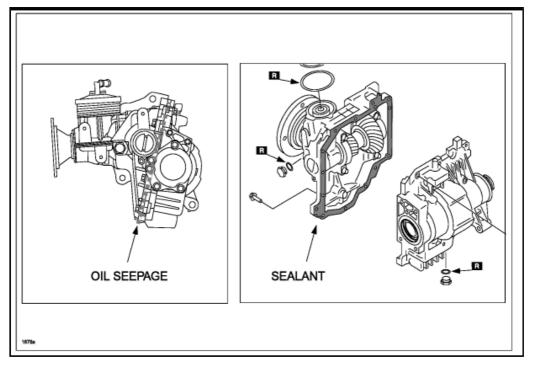

Some vehicles may experience oil seepage from the transfer case in the location shown.

This may be caused by insufficient cleaning of the mating surfaces of the front and rear cases before applying sealant.

The cleaning and assembly process has been improved during production.


Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.

2. Remove transfer case according to Workshop Manual (section 05-17 TRANSFER REMOVAL/INSTALLATION).

3. Completely remove sealant and oil off contact surfaces and bolt holes of both case halves with Brake Clean.

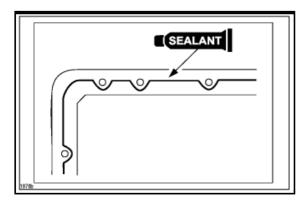

- 4. Apply locally sourced Permatex Ultra Grey RTV sealant to <u>case</u> as shown.
- 5. Reinstall transfer case according to Workshop Manual (section 05-17 TRANSFER REMOVAL/INSTALLATION).
- 6. Verify repair.

Part Number	Description	Qty.	Note
	Permatex Ultra Grey RTV	1	Source sealant locally

PART(S) INFORMATION

 NOTE: This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information. Additional diagnostic time cannot be claimed for this repair. 			
Warranty Type	A		
Symptom Code	76		
Damage Code	9K		
Part Number Main Cause	7777-19-038		
Quantity	0		
Operation Number / Labor Hours:	XXC5LXRX / 4.3 Hrs.		

WARRANTY INFORMATION

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools / equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-&yoursafers." Consumers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determinal the information applies, consumers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determinal the information applies, consumers should not assume this bulleting the technic state of tech

Disclaimer

Account | Vehicle | Help | Contact | Exit

© 2011 ALLDATA, LLC. All Rights Reserved. Trademarks | Privacy Policy | Terms and Conditions